


(a) Dataflow - $PP_{AC} (V_t F_s N_t', V_s G_s F_t)$

Aggregation $V_t F_s N_t'$ Combination: $V_s G_s F_t$

$T_{V_{AGG}}=1, T_{N_t}=1,$ $T_{V_{CMB}}=2, T_{G_s}=2,$
 $T_{F_{AGG}}=4$ $T_{F_{CMB}}=1$

Legend:
 Idle PE
 Aggregation phase on PEs
 Combination phase on PEs

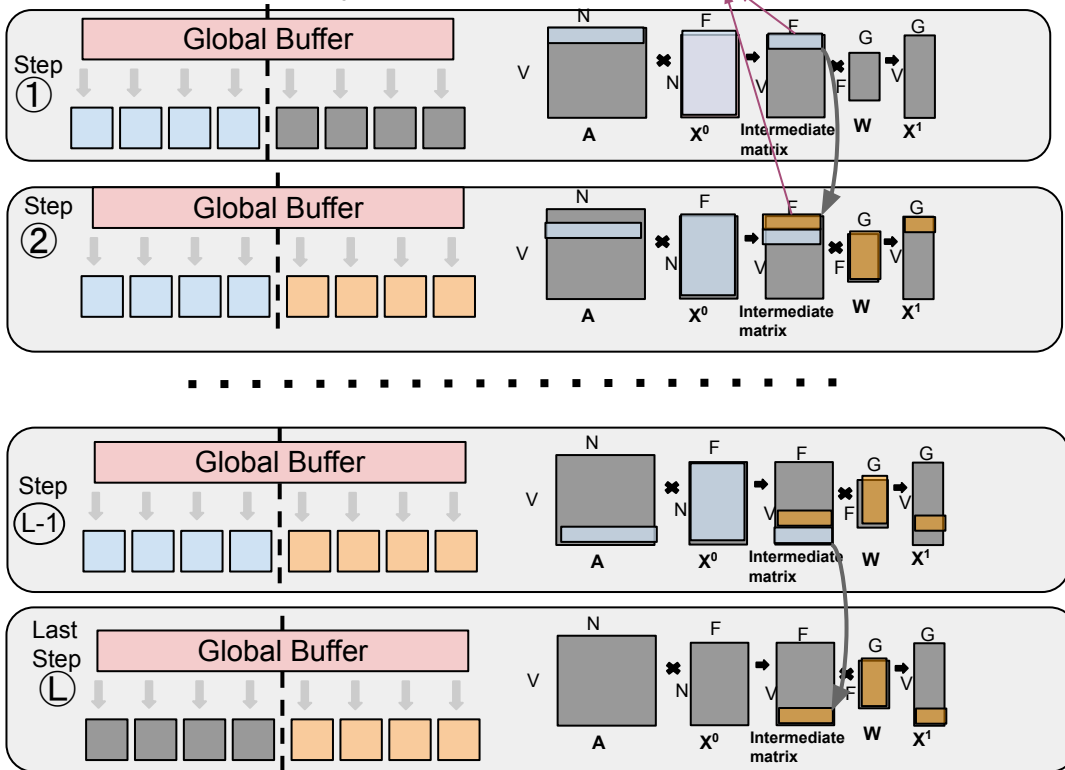


(b) Dataflow - $SP_{AC} (V_t F_s N_t', V_t F_s G_t)$

Aggregation $V_t F_s N_t'$ Combination: $V_s G_s F_t$

$T_{V_{AGG}}=1, T_{N_t}=1,$ $T_{V_{CMB}}=1, T_{G_s}=1,$
 $T_{F_{AGG}}=8$ $T_{F_{CMB}}=8$

Legend:
 Register file (RF).

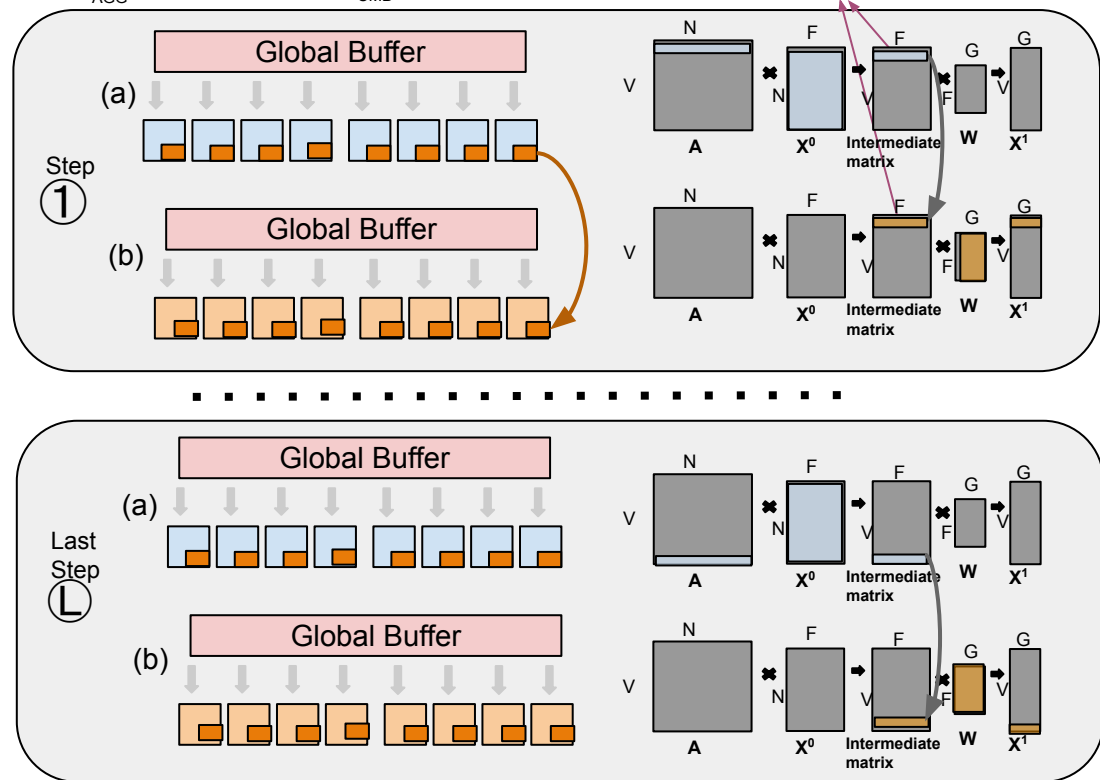

Please note that the A matrix is CSR, only a few columns of A matrix are 1 and consequently only a few rows of X^0 need to be fetched. For simplicity, we highlight the whole X^0 matrix and A matrix row